


# 丸中空リベット

材質：鉄・アルミ・銅・黄銅・ステンレス・その他  
軸径：1.2mm～6mm

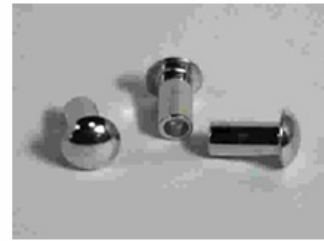

単位:mm

寸法記号	呼び径	1.2	1.6	2.0	2.3	2.5	2.6	3.0	3.5	4.0	4.5	5.0	6.0
d	基準寸法	1.2	1.6	2.0	2.3	2.5	2.6	3.0	3.5	4.0	4.5	5.0	6.0
	許容差	+0.02 -0.05		+0.02 -0.06		+0.02 -0.08		+0.02 -0.10			+0.02 -0.12		
D	基準寸法	2.2	3	3.7	4.3	4.6	4.8	5.4	6.5	7.2	8.3	9	10.5
	許容差	+0 -0.3					+0 -0.4			+0 -0.5		+0 -0.6	
H	基準寸法	0.7	1.0	1.2	1.4	1.5	1.6	1.8	2.1	2.4	2.7	3.0	3.6
	許容差	±0.1					±0.15					±0.2	
A	基準寸法	0.8	1.1	1.3	1.6	1.7	1.8	2.1	2.5	2.8	3.2	3.5	4.2
	許容差	±0.04		±0.05		±0.07		±0.1				±0.12	
B	基準寸法	1.1	1.4	1.8	2.1	2.3	2.3	2.7	3.2	3.6	4.1	4.5	5.4
	許容差	±0.1		±0.15			±0.2			±0.25			±0.3
r	最大	0.06	0.08	0.1		0.2		0.3			0.4		
a1-a2	最大	0.1	0.2					0.3			0.4		
b1-b2	最大	0.1			0.15				0.2			0.3	
C	最大	0.2			0.3			0.4				0.5	

## 寸法

単位:mm

呼び径	1.2	1.6	2.0	2.3	2.5	2.6	3.0	3.5	4.0	4.5	5.0	6.0
d1	1.3	1.7	2.1		3.2		3.2		4.2		5.3	6.3
k	0.7	1	1.2		1.5		1.8		2.4		3	3.6
許容差	4以下	±0.1		±0.15				-				
	4を超え10以下	±0.15		±0.2				±0.25				
	10を超え20以下	±0.2		±0.25				±0.3				
	20を超え40以下	-		±0.3				±0.4				
	40を超えるもの	-		-				±0.5				

## 寸法記号について

d	軸径	A	穴径	?	長さ
D	頭部直径	B	穴の深さ		
H	頭部の高さ	r	首下の丸み		

